


LIFE SAFETY SYSTEMS, INC.®

P.O. Box 76, Essex Jct., VT 05453-0076

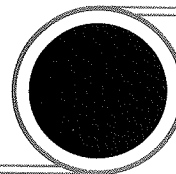

PHONE 802-879-5355

FAX 802-879-4574

IN VERMONT 1-800-649-9995

FIRE ALARM SYSTEM

Test & Inspection Report

VERMONT PROOF OF INSPECTION STICKER # 13-01960

SYSTEM IDENTIFICATION # F-18123

Amended 7-15-13

Customer: Champlain Apartments – 361 Pearl Street

Date: April 11, 2013

Contact: Gene Richards

Location: 361 Pearl Street, Burlington

Time: Start: 1:30 End: 2:45 Total: 1:15

Techs Sent: MF, MC

Panel Make & Model: Silent Knight 5208

Date Installed: June 2007

	(Ah)	<u>AC Line</u>	<u>DC Charge Rate</u>	<u>Battery Voltage Under Load</u>	
				<u>DC Starting</u>	<u>DC Ending</u>
Power Supply (12)		122.4	27.0	26.8	25.4
<u>Manual Pull Stations</u>		Qty: 7	# Zones: 4	Tested: 7	
<u>Signal Horn/Strobes</u>		Qty: 4	# Zones: 1	Tested: 4	
AC Strobes		Qty: 4	# Zones: N/A	Tested: 4	
Penthouse Horn/Strobes		Qty: 1	# Zones: 1	Tested: 1	
<u>Signal Horn/Strobes WP</u>		Qty: 2	# Zones: 1	Tested: 2	
Horns Only		Qty: 10	# Zones: 4	Tested: 10	
<u>Automatic Detection</u>					
Photoelectric Smokes		Qty: 5	# Zones: 4	Tested: 5	
Sprinkler Tamper		Qty: 2	# Zones: 1	Tested: 2	
Sprinkler Flow		Qty: 1	# Zones: 1	Tested: 1	
CO/ Smoke Combos		Qty: 49	# Zones: NA	Tested: 49	
System CO Detector		Qty: 1	# Zones: 1	Tested: 1	

Note: All smoke detectors tested are cleaned.

Auxiliary Features

None

Current Deficiencies

1) Apartment 5 NW bedroom combo disconnected **Verified Corrected 7-15-13**

Deficiencies Corrected

1) **Verified Corrected 7-15-13**

FIRE ALARM SYSTEM
Test & Inspection Report
VERMONT PROOF OF INSPECTION STICKER # 13-01960
SYSTEM IDENTIFICATION # F-18123
Amended 7-15-13

Customer: Champlain Apartments -- 361 Pearl Street


Date: April 11, 2013

Contact: Gene Richards

Location: 361 Pearl Street, Burlington

Comments: 1) Front exit door Apt #3 is Exit of Convenience and has no pull station. 2) Batteries dated June 2011. 3) Apartment 3 has no CO detection outside first two bedrooms: design approved by fire marshal when installed. 4) System CO detector tested with push button to prove initiation of FACP.

Authorized Representative
VT State License #T1-5315


Reviewed by # T1-5334

cc: VT Department of Public Safety - Williston
Burlington Fire Department - Burlington